

Crown Automotive Sales Co., Inc. Cabin Air Filter Kit Part #: 68052292K


## Kit Contents


1- Cabin Air Filter 1- Cabin Air Filter Door Replaces Part #: 5058693AA Replaces Part #: 68052292AA

**NOTE**: Ensure all components in the kit are accounted for.

This kit is designed to retrofit a cabin air filter from a 2015+ Ram Truck onto a 2009-2015 Ram Truck. Included are all the parts needed to perform the installation.

- 1. Disconnect the stopper from the side of the glove box (See Figure 1).
- 2. Remove the glove box by first unseating the 2 upper clips (See Figure 2), followed by the lower clips that the glove box pivots on.

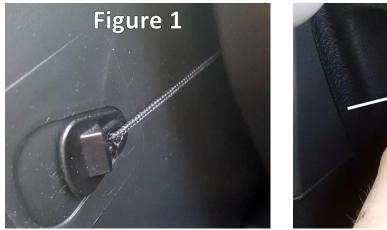

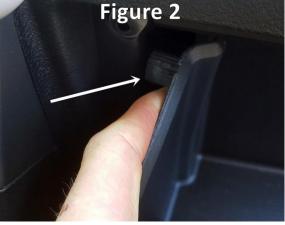

**3.** Mark the area that need to be cut in the HVAC unit (See Figure 3) using a grease pencil or white marker.



- **4.** Using a dremel tool, carefully cut the lines marked on the HVAC unit. Be careful not to cut outside of the marked line on the right as the Cabin Air Filter Door will not seal properly.
- 5. Remove and discard the plastic removed from the HVAC unit.
- 6. Clean up any plastic shavings and sharp edges in or around the HVAC unit.
- 7. Test fit the Cabin Air Filter. Make any additional cuts as needed in order for the filter to slide in and out of the HVAC unit easily.
- 8. Install the Cabin Air Filter and Cabin Air Filter Door. The printing on both the Cabin Air Filter and the Cabin Air Filter Door should be right side up with the arrows pointing down. The door will first hinge on the right side of the HVAC unit, then snap onto the left side.
- 9. Install the glove box by first seating the 3 lower clips followed by the 2 upper clips at the back of the glove box.
- 10. Install the hydraulic stopper onto the side of the glove box. Grabbing the clip on the end of the stopper can be difficult if the glove box is fully installed. Releasing the glove box by the 2 upper clips will give more clearance to the hydraulic stopper.

## ENJOY YOUR FRESH, FILTERED HEAT & AIR CONDITIONING!

While every attempt is made to ensure that the information contained in these instructions is correct, no liability can be accepted by the authors for loss, damage, or injury caused by any errors in, or omissions from the information given. All service should be performed by qualified mechanics. Crown Automotive Sales Co., Inc. cannot be held responsible for any mechanical work performed. Standard and accepted safety precautions should be used in every procedure.